



1. CUT OUT AREA AFFECTED BY ROT (MIN 6" BEYOND VISIBLE DAMAGE PARALLEL TO GRAIN 2" PERPENDICULAR TO GRAIN).

2. DO NOT OVER-CUT (NO SAW KERFS REMAINING). FINISH CUT SURFACES PLUMB, SQUARE, & SMOOTH. CLEAN ALL SURFACES EXPOSED. APPLY SIKADUR 35 HI MOD LV LPL EPOXY ADHESIVE PER MANUFACTURER (SEE SPECS). INSERT AYC BLOCK CUT TO FIT W/ MAX $\frac{1}{8}$ " GAPS.

3. CLAMP TO SET EPOXY.