


ANNULAR SPACE BETWEEN HOLES IN WOOD AND BOLT SHANKS SHALL BE FILLED WITH 3M MARINE GRADE SILICONE SEALANT (CLEAR) P/N 051135-08029

REMOVE SISTERED BOARD AND BOLTS. FILL BOLT HOLES W/ ZINSSER "MH READY PATCH" OR APPROVED ALTERNATIVE

(N) 12x12 BEAM BELOW (CONNECTION NOT SHOWN)

(E) BEAM

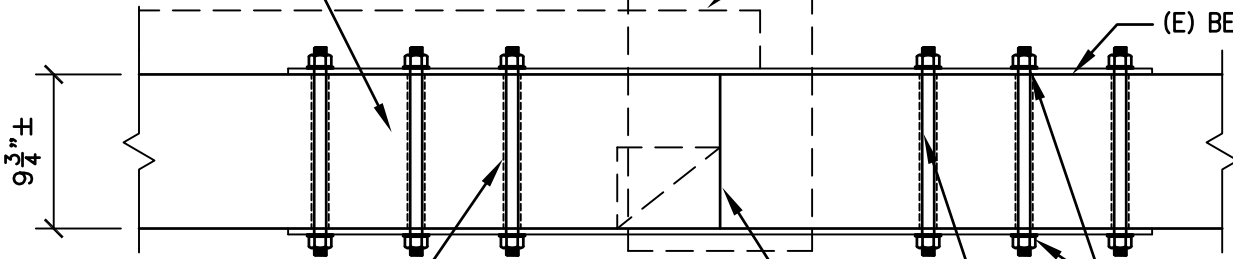


(E) AREA OF DETERIORATION, & (N) WOOD BLOCK, SEE 1/S2 FOR REPAIR

3/8" PLATE 1'-3" X 4'-6" LONG EA SIDE OF BEAM (STAINLESS STEEL T316)

3/4" Ø X 13" LONG T316 STAINLESS STEEL THREADED ROD (12 REQ'D), EMBED IN MARINE SEALANT

(E) SPLICE

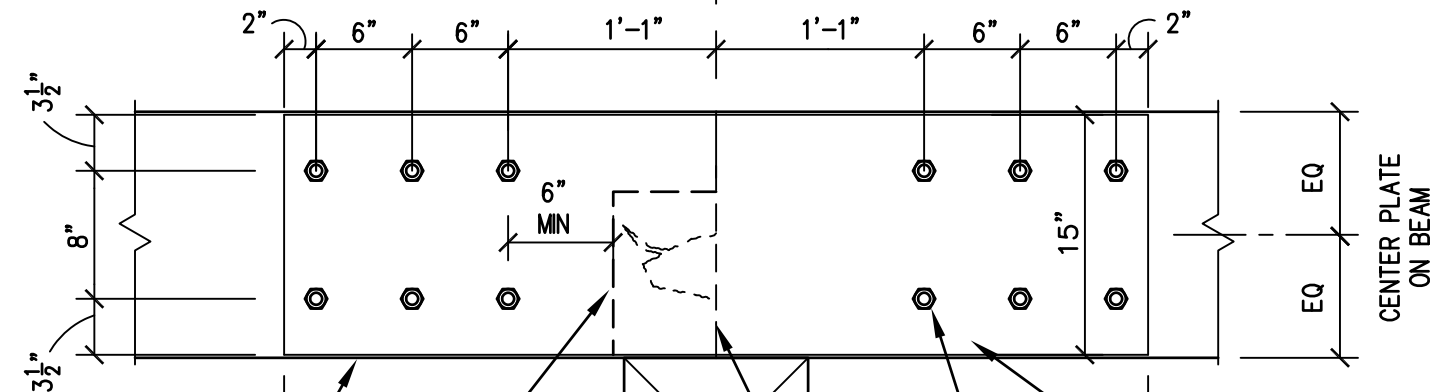

(E) AREA OF DETERIORATION, & (N) BLOCK, SEE 1/S2 FOR REPAIR

3/8" PLATE 1'-3" X 4'-6" LONG EA SIDE OF BEAM (STAINLESS STEEL T316)

12-3/4" Ø X 13" LONG T316 STAINLESS STEEL THREADED ROD W/ T316 HEX NUTS & LOCK WASHERS

(N) BEAM PTGC-6%

(E) SPLICE

B ELEVATION LOOKING NORTH

1
S1

CONTINUITY (SPLICE) PLATE AT (E) BEAM ABOVE

(N) BEAM AT 6C